


**Panel Antenna**

174-240 MHz

H V X


- Dual-polarized antenna (horizontal/vertical).
- Optionally circular or slant polarization.
- For TV and DAB in one system.

<b>Part Number</b>	<b>75010085</b>
<b>Input</b>	2 x 7-16 female
<b>Max. power</b>	2 kW per input
<b>Frequency range</b>	174-240 MHz
<b>VSWR</b>	174-223 MHz: < 1.1 174-240 MHz: < 1.2
<b>Gain (at mid-band)</b>	7.5 dBd (linear polarization) 4.5 dBd (circular polarization)
<b>Impedance</b>	50 Ohm
<b>Polarization</b>	horizontal, vertical, slant, circular
<b>Dimensions</b>	W: 1300 mm x H: 1300 mm x D: 465 mm
<b>Weight</b>	35 kg
<b>Wind load (at 160 km/h)</b>	Frontal: 850 N Lateral: 720 N
<b>Max. wind velocity</b>	225 km/h

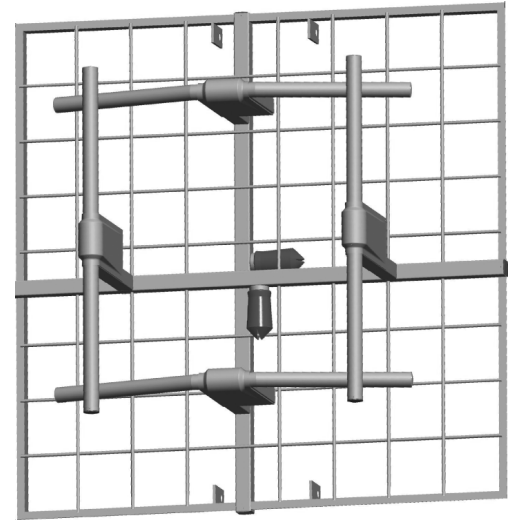


- Material** Hot-dipped galvanized steel.  
Protective cover: Fiberglass.
- Mounting** Using M16 screws (supplied) to suitable attachment construction.  
Mounting dimensions upon request.
- Grounding** Via mounting parts.
- Ice protection** Even under severe icy conditions, the antenna is still functional due to its heavy duty construction and the fiberglass feedpoint covers.
- Scope of supply** Antenna supplied without clamps.
- Note** Nominal Dimensions: For detailed information, please refer to the technical drawing.

**Mid-band radiation patterns for horizontal polarization**

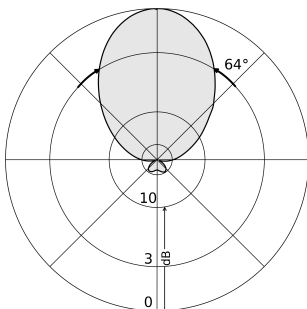


Horizontal Radiation Pattern

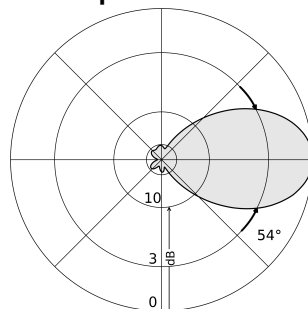


Vertical Radiation Pattern

**Mid-band radiation patterns for vertical polarization**

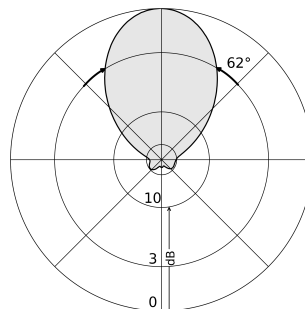

Horizontal Radiation Pattern

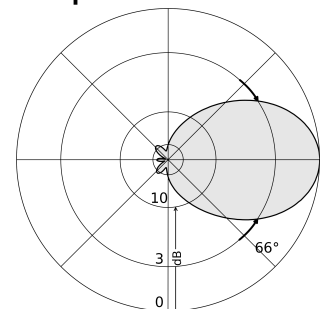

Vertical Radiation Pattern

**Please note**

**As a result of more stringent legal regulations and judgements regarding product liability, we are obliged to point out certain risks that may arise when products are used under extraordinary operating conditions.**

The mechanical design is based on the environmental conditions as stipulated in ETS 300 019-1-4 and thereby respects the static mechanical load imposed on an antenna by wind at maximum velocity.

Extraordinary operating conditions, such as heavy icing or exceptional dynamic stress (e.g. strain caused by oscillating support structures), may result in the breakage of an antenna or even cause it to fall to the ground.

Cylindrical bodies can show crosswind response, which can cause the supporting structure to oscillate and to be damaged. Prismatic bodies, even with non-circular cross-section can show crosswind response, which can cause the supporting structure to oscillate (see EN 1991-1-4 or EN 1993-3-1).

These facts must be considered during the site planning process.

The maximum wind velocities listed should be understood in the sense of working values according to DIN and EN standards. These values include a safety factor (1.5) below the ultimate limit state (elastic limit or permanent deformation). For these wind velocities we guarantee the mechanical safety and the electrical integrity of our antennas.

**The installation team must be properly qualified and also be familiar with the relevant national safety regulations.**

**The details given in our data sheets have to be followed carefully when installing the antennas and accessories.**

**The limits for the coupling torque of RF-connectors, recommended by the connector manufacturers must be obeyed.**

**Any previous data sheet issues have now become invalid.**

Our quality assurance system applies to the entire company and is certified to EN ISO 9001.